



Stack Bros.
3119 Hill Ave. Superior WI

Tel: 7153982964

Fax:

E-mail:

Inspection Report

MH06112A-MH060114

Date 4/25/2019	P/O. No.	Weather Dry	Surveyor's Name Josh Gordon	Pipe Segment Reference MH060114 - MH06112A	Section No. 8
Certificate No. U-215-06023623	Survey Customer	System Owner	Preset :	Pre-Cleaning No Pre-Cleaning	Sewer Category

Street St. Albans Culdassack	Use of Sewer Combined	Upstream MH MH060114
City City of Superior	Drainage Area District 6	Downstream MH MH06112A
Loc. details Light Highway	Flow Control	Dir. of Survey Downstream
Location Code	Length surveyed 266.21 ft	Section Length 266.21 ft

Purpose of Survey Maintenance Related	Joint Length	8 inch
Year Laid	Dia./Height	Vitrified Clay Pipe
Year Rehabilitated 1000	Material	
Tape / Media No. 979	Lining Method	

Add. Information :

1:216	Position	Code	Observation	Photo	Grade
	0.00	AMH	Manhole, MH060114 / MH060114		
	0.00	MWL	Water Level, 5 % of cross sectional area		
	15.58	S1	CL Crack Longitudinal, at 12 o'clock, within 8 inch, Start		
	27.10	CS	Crack Spiral, from 12 o'clock, to 1 o'clock, within 8 inch		
	34.09	CM	Crack Multiple, from 8 o'clock, to 12 o'clock		
	34.94	CM	Crack Multiple, from 11 o'clock, to 1 o'clock, within 8 inch		
	37.76	CH3	Crack Longitudinal Hinge, 3, at 12 o'clock, within 8 inch		
	41.24	CH3	Crack Longitudinal Hinge, 3, at 12 o'clock, within 8 inch		
	43.31	CH4	Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch		
	46.29	CH4	Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch		
	48.06	S2	CH4 Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch, Start		
	65.78	E2	CH4 Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch, Finish		
	69.16	E1	CL Crack Longitudinal, at 12 o'clock, within 8 inch, Finish		
	85.40	S3	CH4 Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch, Start		



Stack Bros.
 3119 Hill Ave. Superior WI
 City :
 Tel: 7153982964
 Fax:
 Email:

Inspection Report

Date	P/O. No.	Weather Dry	Surveyor's Name Josh Gordon	Pipe Segment Reference	Section No.
Certificate No. U-215-06023623	Survey Customer	System Owner	Preset :	Cleaned : No Pre-Cleaning	Sewer Category

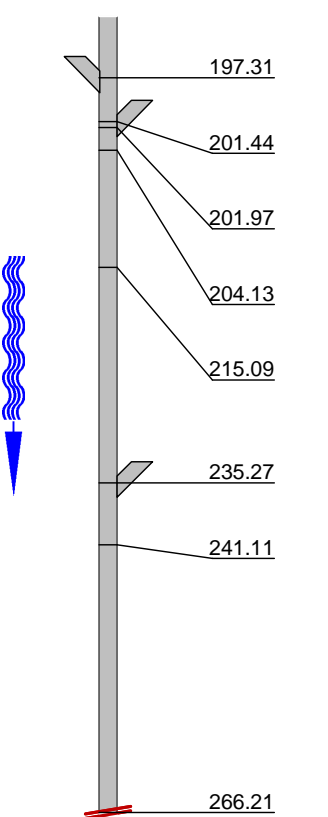
1:216	Position	Code	Observation	Photo	Rate
	<u>85.47</u>	DSF	Deposits Settled Fine, 10 % of cross sectional area, at 6 o'clock, within 8 inch		
	<u>91.70</u>	E3 CH4	Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch, Finish		
	<u>91.70</u>	CL	Crack Longitudinal, at 12 o'clock, within 8 inch		
	<u>98.59</u>	CL	Crack Longitudinal, at 12 o'clock, within 8 inch		
	<u>100.10</u>	CH4	Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch		
	<u>102.79</u>	CH2	Crack Longitudinal Hinge, 2, at 12 o'clock, within 8 inch		
	<u>105.32</u>	CL	Crack Longitudinal, at 12 o'clock, within 8 inch		
	<u>105.32</u>	CL	Crack Longitudinal, at 9 o'clock, within 8 inch		
	<u>107.55</u>	CH4	Crack Longitudinal Hinge, 4, at 12 o'clock, within 8 inch		
	<u>110.11</u>	CM	Crack Multiple, from 5 o'clock, to 11 o'clock, within 8 inch		
	<u>113.12</u>	CL	Crack Longitudinal, at 11 o'clock, within 8 inch		
	<u>145.57</u>	CM	Crack Multiple, from 10 o'clock, to 2 o'clock, within 8 inch		
	<u>152.30</u>	MWM	Water Mark, 50 % of cross sectional area		
	<u>152.30</u>	DSF	Deposits Settled Fine, 10 % of cross sectional area, at 6 o'clock		
	<u>178.84</u>	CL	Crack Longitudinal, at 12 o'clock, within 8 inch		
	<u>181.23</u>	CL	Crack Longitudinal, at 12 o'clock, within 8 inch		
	<u>183.96</u>	DSF	Deposits Settled Fine, 5 % of cross sectional area, at 6 o'clock		
	<u>191.57</u>	DSF	Deposits Settled Fine, 10 % of cross sectional area, at 6 o'clock		



Stack Bros.
 3119 Hill Ave. Superior WI
 City :
 Tel: 7153982964
 Fax:
 Email:

Inspection Report

Date	P/O. No.	Weather Dry	Surveyor's Name Josh Gordon	Pipe Segment Reference	Section No.
Certificate No. U-215-06023623	Survey Customer	System Owner	Preset :	Cleaned : No Pre-Cleaning	Sewer Category

1:216	Position	Code	Observation	Photo	Rate		
	197.31	TFA	Tap Factory Made Active, at 3 o'clock, 6 inch dim				
	201.44	TFA	Tap Factory Made Active, at 9 o'clock, 6 inch dim				
	201.97	CL	Crack Longitudinal, at 11 o'clock, within 8 inch				
	204.13	CL	Crack Longitudinal, at 12 o'clock, within 8 inch				
	215.09	MWM	Water Mark, 100 % of cross sectional area				
	235.27	TFC	Tap Factory Made Capped, at 9 o'clock, 6 inch dim				
	241.11	CL	Crack Longitudinal, at 11 o'clock, within 8 inch				
	266.21	MSA	Survey Abandoned, wheels spinning / wheels spinning				
QSR	QMR	SPR	MPR	OPR	SPRI	MPRI	OPRI