



Stack Bros.
3119 Hill Ave. Superior WI

Tel: 7153982964

Fax:

E-mail:

Inspection Report

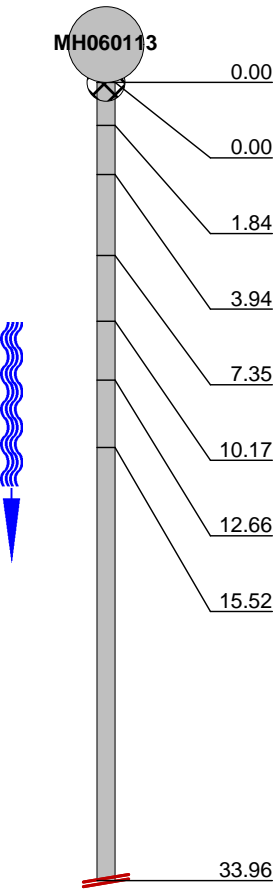
PF060776-MH060113

Date 5/10/2023	P/O. No.	Weather Dry	Surveyor's Name Josh Gordon	Pipe Segment Reference MH060113 PF060776	Section No. 4
Certificate No. U-215-06023623	Survey Customer	System Owner	Preset :	Pre-Cleaning No Pre-Cleaning	Sewer Category

Street At end Newton	Use of Sewer Sanitary	Upstream MH MH060113
City City of Superior	Drainage Area District 6	Dowstream MH PF060776
Loc. details	Flow Control	Dir. of Survey Downstream
Location Code Woods	Length surveyed 33.96 ft	Section Length 33.96 ft

Purpose of Survey Pre-Rehabilitation Survey	Joint Length	8 inch
Year Laid	Dia./Height	Vitrified Clay Pipe
Year Rehabilitated 1000	Material	
Tape / Media No. 1130	Lining Method	

Add. Information :

1:98	Position	Code	Observation	Photo	Grade		
	MH060113						
	0.00	AMH	Manhole, MH060113 / MH060113				
	0.00	MWL	Water Level, 5 % of cross sectional area				
	1.84	DAR	Deposits Attached Ragging, 10 % of cross sectional area, from 12 o'clock, to 12 o'clock				
	3.94	DAE	Deposits Attached Encrustation, 5 % of cross sectional area, from 12 o'clock, to 12 o'clock				
	7.35	RMJ	Roots Medium Joint, from 12 o'clock, to 12 o'clock, 45 % lost, within 8 inch				
	10.17	RMJ	Roots Medium Joint, from 12 o'clock, to 12 o'clock, 45 % lost, within 8 inch				
	12.66	S1 RMJ	Roots Medium Joint, from 12 o'clock, to 12 o'clock, 45 % lost, within 8 inch, Start				
15.52	MWL	Water Level, 40 % of cross sectional area					
	33.96	MSA	Survey Abandoned, high water and debris in pipe / high water and debris in pipe				
QSR	QMR	SPR	MPR	OPR	SPRI	MPRI	OPRI